



CUSTOMER

Sarah & Mike Thompson

JOB SITE

Belmont, NC


POURED

Tue, Oct 6, 2026

CREW LEAD


Marcus D.

Your project

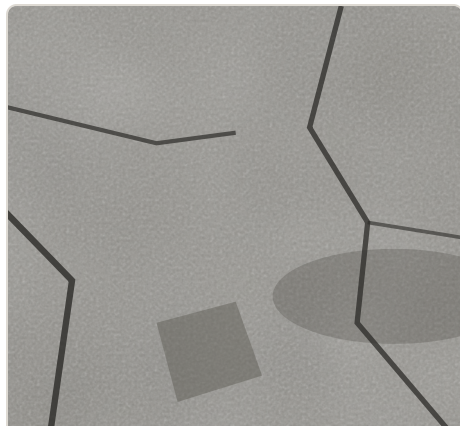

Before

Cracked & settled

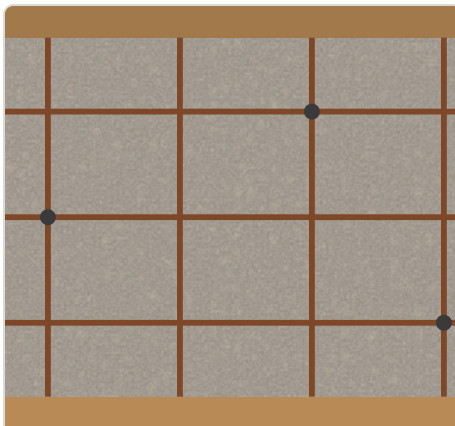

Prep

Base, forms & rebar



After

Broom finish, saw-cut joints

What we poured

Area	640 sq ft (32 ft x 20 ft)
Thickness	4 in, thickened to 5 in at the apron
Concrete mix	4,000 PSI, air-entrained, 3/4 in stone
Reinforcement	#3 rebar on 18 in centers, on chairs, plus fiber
Base	4 in crushed stone (ABC), compacted
Control joints	Saw-cut 1 in deep, about every 10 ft
Expansion joints	At the garage slab and the street
Finish	Light broom, across the slope for traction
Slope	Drains away from the garage, about 1/4 in per ft

Checked before the pour

- ✓ 811 utility locate called in
Ticket #A2627904118, marked Oct 1
- ✓ Old concrete removed & hauled off
About 7 tons, recycled
- ✓ Base graded & compacted
Plate compactor, 2 passes
- ✓ Forms set to grade & slope
Checked with laser level
- ✓ Rebar placed on chairs
Sits mid-slab, not on the ground
- ✓ Weather checked
64°F, partly cloudy, 0% rain at pour time

CONCRETE
9.5 yd³TRUCKS
2TICKETS
#88412,
#88419

M

NOTE FROM THE CREW

We thickened the apron to 5 inches because delivery trucks turn in from the street there, and we pitched the slab a little more along the garage side so rain runs off toward the yard instead of the door. Thanks for having us out.

**The first 28 days****Day 0****Stay off it**

No foot traffic for the first 24 hours. Keep pets and kids off too.

Day 1**Walk on it**

Foot traffic is fine. Still no cars, bikes or heavy items.

Day 7**Park on it**

Regular cars and SUVs are OK. Avoid sharp turns in one spot.

Day 28**Full strength**

Trucks, trailers and RVs are OK. Time to think about sealer.

Good to know**No salt the first winter**

Rock salt and de-icers can flake new concrete. Use sand for traction this first winter, and only use concrete-safe de-icers after that.

About cracks

All concrete shrinks as it cures. The saw-cut joints are there so it cracks in straight lines inside the joints. A hairline crack is normal and not a structural problem.

Seal it after 30 days

A quality sealer keeps out water, oil and salt and makes cleaning easier. Reseal every 2 to 3 years. We can do it for you.

Keep water moving

Point downspouts away from the slab and don't let soil wash out along the edges. Water under the slab is what causes settling.

Your warranty**2-Year Workmanship Warranty**

If the driveway settles, heaves, or cracks outside the control joints because of how we built it, we'll come back and make it right. Normal hairline cracks, salt damage, and damage from heavy equipment are not covered.

WARRANTY NO.

GRW-2186

VALID THROUGH

Oct 6, 2028

We'll text you a reminder in **October 2028** when it's time to reseal, so your driveway stays protected.

**How did we do?**

If you're happy with your new driveway, a quick Google review helps a small local business more than anything. Scan the code, it takes about a minute.

